
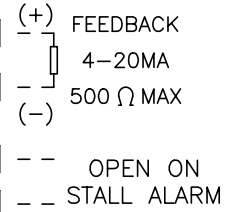


- NOTES:
1. SEE INSTRUCTION MANUAL FOR OTHER FEEDBACK CONFIGURATIONS.
 2. WIRING IS SHOWN FOR EXTEND-IS-FWD. IF RETRACT-IS-FWD, P4 IS REVERSED, P3-3 CONNECTS TO S3 AND P3-1 CONNECTS TO S4.
 3. FIELD WIRING TERMINAL: #
 4. INPUT/FEEDBACK SIGNALS: ISA TYPE 4, CLASS L, POWER ISOLATED.

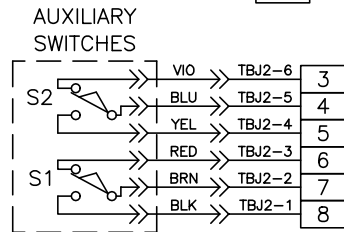

17-4207-02o A

SIZE:
A

THIS DOCUMENT IS A COPY AND IS NOT THE SOURCE DOCUMENT. INFORMATION IS SUBJECT TO CHANGE WITHOUT NOTICE. THE INFORMATION CONTAINED HEREIN IS COPYRIGHTED BY HAROLD BECK AND SONS, INC. CHANGES TO THE DOCUMENT ARE PROHIBITED. CONTACT A BECK SALES ENGINEER IF A CERTIFIED DRAWING IS REQUIRED.

HAROLD BECK & SONS INC

NEWTOWN INDUSTRIAL COMMONS NEWTOWN, PENNSYLVANIA 18940 USA

TITLE:

WIRING DIAGRAM GROUP 42-XX7
120 VOLT 2 AUX SWITCHES

DRAWN:
CHH 10-11-07

SCALE:
NONE

DRAWING NO:

REV:

CHECKED:
GMD 10/15/07

17-4207-02o

A

APPROVED:
JHM 10/16/07

SHEET NO. 1 OF 1